


MONUMENT RECORD

Corner ID: **Per_C09**

Quarter Corner


Section 7 & 18- T08N-R01W, 2nd P.M.
Perry Township, Monroe County, Indiana

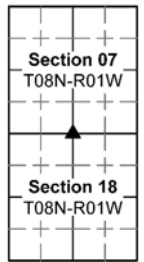

MONUMENT: Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)

1 1/4" "Monroe County Surveyor" Cap set on 5/8 Inch Rebar found, replacing deteriorated yellow "Bynum Fanyo 890006" cap 0.1' below grade, 1' south of asphalt path and 20.9' north of backside of curb on north side of Tapp Road.

MONUMENT LOCATION SKETCH:

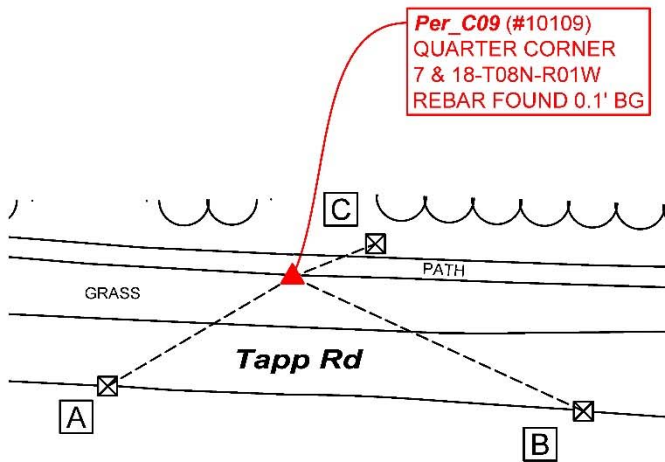

WITNESS MONUMENT TIES

All ties to new Bearing Trees (BTs) are a mag nail set in a 1-1/2" plastic washer stamped "SURVEY MARKER - DO NOT REMOVE" and hack mark at the root crown (less than 12" above ground) perpendicular to the center of the tree, unless otherwise noted. BT diameters are noted as dbh and are measured approximately 4.5' above ground. Bearings are measured from the monument to the center of the BT, distances are measured from the monument to the mag nail.

ID	BEARING	DISTANCE	DESCRIPTION
Witness A	S 59d W	89.7'	Cut "X" set in back, west side of curb water inlet, southwest of monument, south side of Tapp Rd.
Witness B	S 65d E	134.0'	Cut "X" set in back, west side of curb water inlet, southeast of monument, south side of Tapp Rd
Witness C	N 68d E	37.4'	Cut "X" set on west side of rim of 7" water valve, 6.2' north of path, northeast of monument.



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 1 of 3

MONUMENT RECORD

Corner ID: **Per_C09**

Quarter Corner

Section 7 & 18- T08N-R01W, 2nd P.M.
Perry Township, Monroe County, Indiana

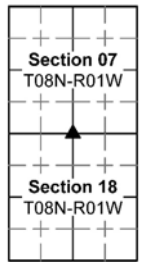


PHOTO IDENTIFIED: Photo Date: 09/30/2021



Photo Orientation & Description: Per_C09 from above

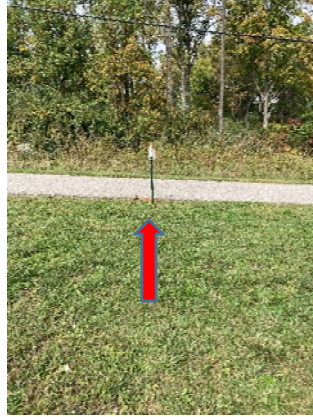


Photo Orientation & Description: Looking north at Per_C09



Photo Orientation & Description: Looking east at Per_C09



Photo Orientation & Description: Looking south at Per_C09



Photo Orientation & Description: Looking west at Per_C09



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph


119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyorsoffice@co.monroe.in.us

MONUMENT RECORD

Corner ID: **Per_C09**

Quarter Corner

Section 7 & 18- T08N-R01W, 2nd P.M.
Perry Township, Monroe County, Indiana

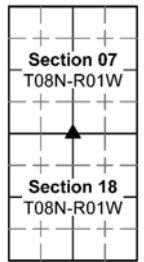

ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND: *Include, search area or areas, search procedure, etc.*

Date of Field work/Search: 09/30/2021 By: RSO, TER, JG Monument Found: Rebar with Bynum Fanyo 890006 Cap BTs or Reference Objects Found: None Project #: Per_C09 Field Book: 54/36 Equipment: The basis of bearings is Grid North System NAD83(2011)/Indiana West NAVD 88, Epoch 2010.0000, geoid12b_conus.db3, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Coordinate data was collected with a Javad Triumph LS Network Rover. Coordinates are available upon request. Distances to witness ties were calculated by points gathered with the Javad Triumph LS Network Rover. Bearings to witness ties were collected with the internal magnetic compass of the Javad Triumph LS and were automatically adjusted to grid north and are approximately shown hereon for reference. Priority should be given to provided distances over bearings. Notes: All witness photos on file in the Monroe County Surveyors Office.

OTHER EVIDENCE: *Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.*

Monument found in the grass area 1 foot south of the 8 foot wide path and 20.9 feet north of backside of curb on the north side of Tapp Rd.

MONUMENT PRESERVATION: *Describe work done to preserve existing monument.*

Bynum Fanyo 890006 cap was found askew and deteriorated. This cap was replaced with a one and one quarter inch aluminum Monroe County Surveyor cap. "Protect Nearby Survey Marker" sign was set 6" south of monument at 3' above grade.

THEORY OF LOCATION: *Describe the theory of location for acceptance of this monument. Include monument origin and associated uncertainty.*

The rebar was previously witnessed by the Monroe County Surveyor, Kevin Enright, on August 21, 2000 and accepted by the Monroe County Surveyor Review Board on December 14, 2000. The 2000 Monument Record accepted the rebar per a survey for the City of Bloomington Utilities by Kevin Potter recorded as Instrument Number 417041.IN. References on File: Ben Bledsoe survey, Sudbury Property (2014) on file in the Records Office 2014004467.IN. Historic research has not yet been performed to prove the validity of this monument.

CERTIFICATION:



Date: 12/09/2021
Trohn Enright-Randolph
Monroe County Surveyor



Date: 12/09/2021
Accepted by the
Monroe County Surveyor
Review Board



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyorsoffice@co.monroe.in.us

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 7 Township: 8N Range: 1W

Corner ID: Per C- 09


Monument Description & Remarks: 5/8" rebar with twisted metal fence post witness 3.7' north of concrete rain culvert.

References On File: City of Bloomington Utilities Survey by Kevin Potter.
Recorders Book #3 page 245.


Field Book: 2000-02

Page No.: 20

USGS Quad: Bloomington

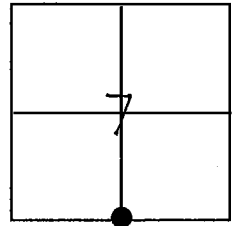


Tie Sheet Drawing
(Not to Scale)

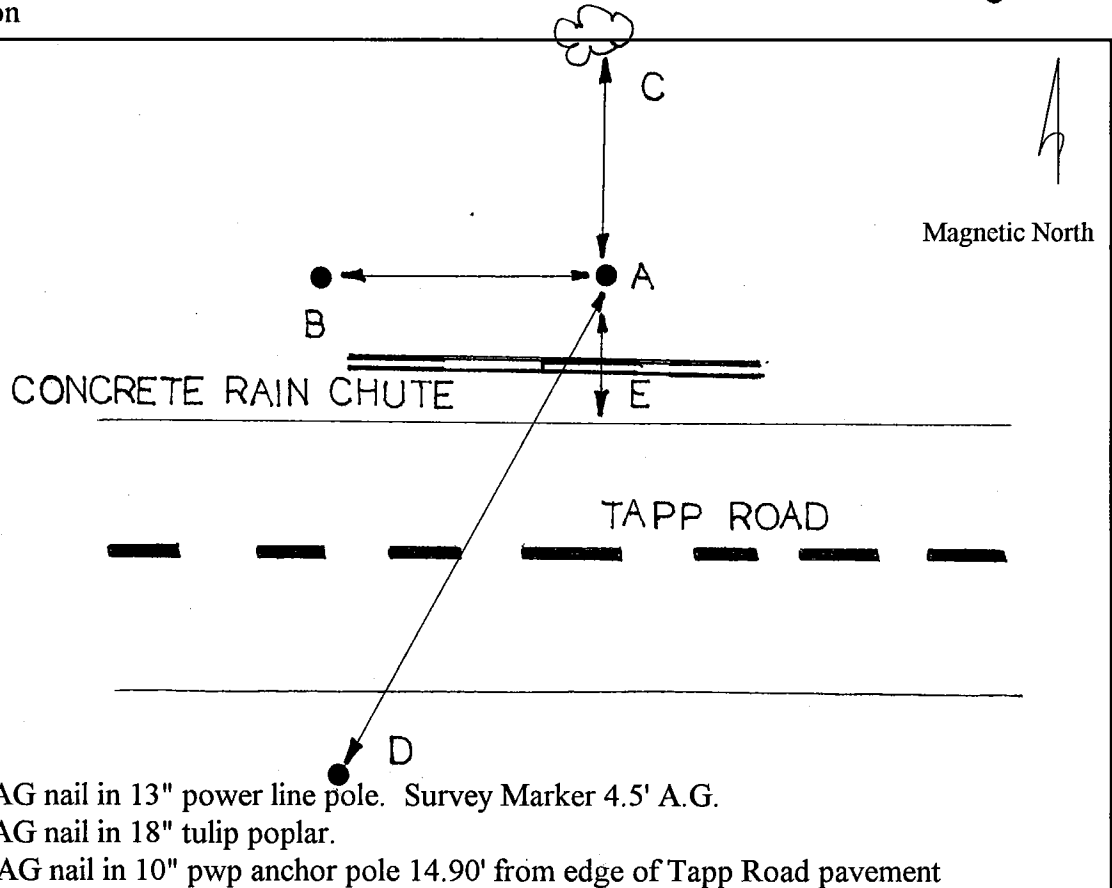

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 36-2-12-11 of the Indiana Code; and the above data is given under my hand this 21st day of August, 2000.

Kevin Enright

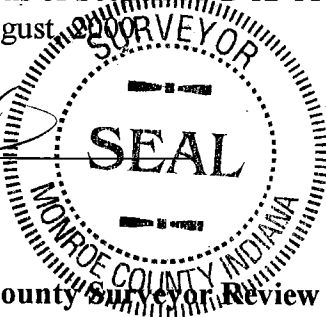

Certified and sealed by the Monroe County Surveyor Review Board

Date: *December 14, 2000*

November 28, 2000